
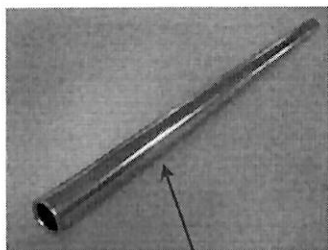


Adopted solutions on production:**Step 1 – Temporary solution**

A temporary solution was adopted on machines produced from end of June 2015 from serial number 150617047Z by adding the metal pipe p/n 137869111/0 working as cable reinforcement. This solution was previously announced with Service Bulletin FM-039 and has been replaced by the final solution described on step 2.

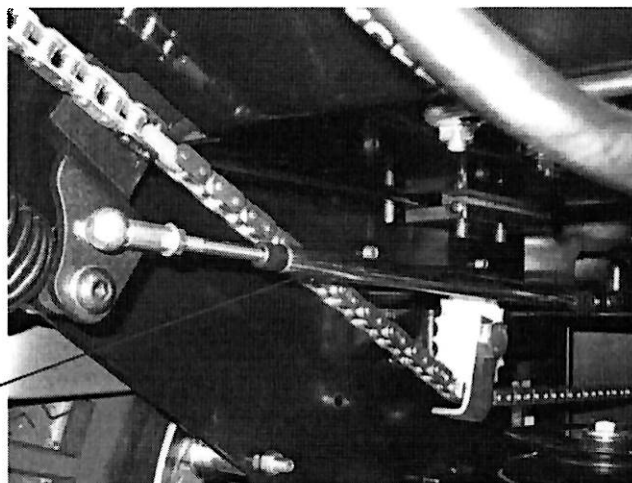


reinforcement pipe
p/n 137869111/0

**Step 2 – Final solution**

As final solution, the machines produced from November 2016 with serial number higher than 161102011Z have a new speed cable p/n 187000210/0 with a mounting system preventing the rigid end of the cable from bending.

The new solution does not require anymore the use of the reinforcement pipe p/n 137869111/0. Below drawings show the difference between old and new solution.

Old

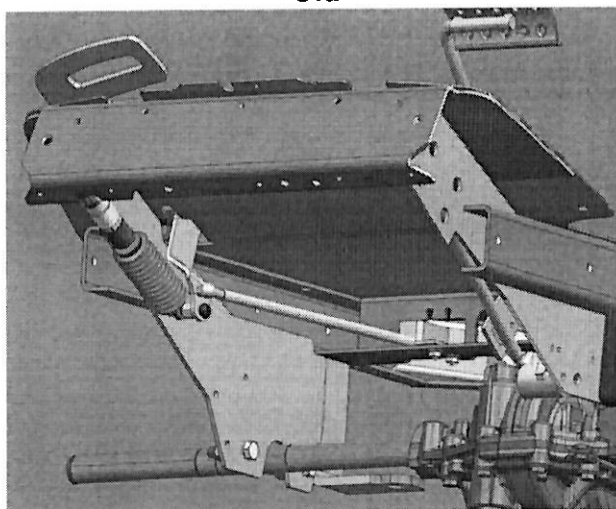

New

