

SERVICE BULLETIN

GGP CUSTOMER SERVICE

No. FM-052

DATA 24/02/2017

PAGE 1 of 3

PRIORITY LEVEL

Urgent

Important

Information

Object : **Park Pro – Speed cable**

Involved Machines:



PARK PRO 340 IX Art. Nr.13-6451-11

PARK PRO 540 IX Art. Nr.13-6471-11

PARK PRO 740 IOX Art. Nr.13-6491-11

Year of production: **2014 and 2016**



Important : the present Bulletin FM-052 cancels and substitutes the Bulletin FM-039 dated 26 of June 2015.

Problem:

It has been found that the above mentioned machines might reveal a failure on the speed control cable p/n 187000200/0 after several working hours. The rigid end of the cable get permanently bent on the side where it is fixed on the speed pedal. The failure results in a not operating speed control system.

